

Geotechnical Engineering Investigation

Proposed Industrial Warehouse Development
12352 Whittier Boulevard
Whittier, California

Western Realco
500 Newport Center Drive, Suite 630
Newport Beach, California 92660

Attn: Mr. Jeremy Mape

Project Number 22416-21
April 2, 2021

NorCal Engineering

TABLE OF CONTENTS

Section	Page
1.0 Project Description	2
2.0 Site Description	2
3.0 Site Exploration	2
4.0 Laboratory Tests	3
4.1 Field Moisture Content.....	3
4.2 Maximum Density Tests	3
4.3 Expansion Index Tests	3
4.4 Atterberg Limits.....	4
4.5 Corrosion Tests.....	4
4.6 R-Value Test.....	4
4.7 Direct Shear Tests.....	4
4.8 Consolidation Tests.....	4
5.0 Seismicity Evaluation	4
6.0 Liquefaction Evaluation	5
7.0 Infiltration Characteristics	5
8.0 Conclusions and Recommendations	7
8.1 Site Grading Recommendations.....	7
8.1.1 Removal and Recomaction Recommendations.....	8
8.1.2 Fill Blanket Recommendations.....	9
8.2 Shrinkage and Subsidence.....	9
8.3 Temporary Excavations.....	9
8.4 Foundation Design.....	10
8.5 Settlement Analysis.....	10
8.6 Lateral Resistance.....	10
8.7 Retaining Wall Design Parameters.....	11
8.8 Slab Design.....	12
8.9 Pavement Section Design.....	12
8.10 Utility Trench and Excavation Backfill.....	13
8.11 Corrosion Design Criteria.....	14
8.12 Expansive Soil.....	14
9.0 Closure	14

NorCal Engineering
Soils and Geotechnical Consultants
10641 Humbolt Street Los Alamitos, CA 90720
(562) 799-9469 Fax (562) 799-9459

April 2, 2021

Project Number 22416-21

Western Realco
500 Newport Center Drive, Suite 630
Newport Beach, California 92660

Attn: Mr. Jeremy Mape

RE: **Geotechnical Engineering Investigation** - Proposed Industrial Warehouse
Development - Located at 12352 Whittier Boulevard, in the City of Whittier,
California

Dear Mr. Mape:

Pursuant to your request, this firm has performed a Geotechnical Engineering Investigation for the above referenced project in accordance with your approval of our proposal dated March 3, 2021. The purpose of this investigation is to evaluate the geotechnical conditions of the subject site and to provide recommendations for the proposed industrial warehouse development.

The scope of work included the following: 1) site reconnaissance; 2) subsurface geotechnical exploration and sampling; 3) laboratory testing; 4) soil infiltration testing; 5) engineering analysis of field and laboratory data; 6) preparation of a geotechnical engineering report. It is the opinion of this firm that the proposed development is feasible from a geotechnical standpoint provided that the recommendations presented in this report are followed in the design and construction of the project.

1.0 Project Description

It is proposed to construct an industrial warehouse development consisting of four buildings with total footprint of 270,500 square feet as shown on the attached Site Plan by Bastien and Associates, Inc Architecture and Planning. The proposed concrete tilt-up buildings will be supported by a conventional slab-on-grade foundation system with perimeter-spread footings and isolated interior footings. Other improvements will include asphalt and concrete pavement areas, hardscape and landscaping. It is assumed that the proposed grading for the development will include cut and fill procedures on the order of a few feet to achieve finished grade elevations. Final building plans shall be reviewed by this firm prior to submittal for city approval to determine the need for any additional study and revised recommendations pertinent to the proposed development, if necessary.

2.0 Site Description

The 13.49-acre subject property is located within the 12300 block and south side of Whittier Boulevard, in the City of Whittier. The generally irregular-shaped parcel is elongated in a north to south direction with topography of the relatively level descending gradually from a northwest to southeast direction on the order of a few feet. The site is occupied by an abandoned concrete tilt-up warehouse building with surrounding asphalt and concrete pavement.

3.0 Site Exploration

The investigation consisted of the placement of eleven (11) subsurface exploratory borings by a truck mounted hollow stem auger to depths ranging between 5 and 25 feet below current ground elevations. The explorations were visually classified and logged by a field engineer with locations of the subsurface explorations shown on the attached plan. The exploratory borings revealed the existing earth materials to consist of fill and natural soil. Detailed descriptions of the subsurface conditions are listed on the boring logs in Appendix A. It should be noted that the transition from one soil type to another as shown on the boring logs is approximate and may in fact be a gradual transition. The soils encountered are described as follows:

Fill: A fill soil classifying as a brown, fine to medium grained, clayey SILT with occasional gravel was encountered across the site to depth of 1 to 6 feet below ground surface. These soils were noted to be firm to stiff and moist.

Natural: A natural undisturbed soil classifying as a brown, clayey to sandy SILT to a silty CLAY was encountered beneath the fill soils. The native soils were observed to be firm to stiff and moist. Deeper soils encountered consisted of a sandy SILT to a silty CLAY which were noted to be firm to stiff and moist.

The overall engineering characteristics of the earth material were relatively uniform with each excavation. Groundwater was not encountered to the depth of our borings and no caving occurred.

4.0 Laboratory Tests

Relatively undisturbed samples of the subsurface soils were obtained to perform laboratory testing and analysis for direct shear, consolidation tests, and to determine in-place moisture/densities. These relatively undisturbed ring samples were obtained by driving a thin-walled steel sampler lined with one-inch long brass rings with an inside diameter of 2.42 inches into the undisturbed soils. Bulk bag samples were obtained in the upper soils for expansion index tests and maximum density tests. All test results are included in Appendix B, unless otherwise noted.

4.1 **Field Moisture Content** (ASTM: D 2216) and the dry density of the ring samples were determined in the laboratory. This data is listed on the logs of explorations.

4.2 **Maximum Density tests** (ASTM: D 1557) were performed on typical samples of the upper soils. Results of these tests are shown on Table I.

4.3 **Expansion Index tests** (ASTM: D 4829) were performed on remolded samples of the upper soils to determine expansive characteristics. Results of these tests are provided on Table II.

- 4.4 **Atterberg Limits** (ASTM: D 4318) consisting of liquid limit, plastic limit and plasticity index were performed on representative soil samples. Results are shown on Table III.
- 4.5 **Corrosion tests** consisting of sulfate, pH, resistivity and chloride analysis to determine potential corrosive effects of soils on concrete and underground utilities. Test results are provided on Table IV.
- 4.6 **R-Value test** per California Test Method 301 was performed on a representative sample, which may be anticipated to be near subgrade to determine pavement design. Results are provided within the pavement design section of the report.
- 4.7 **Direct Shear tests** (ASTM: D 3080) were performed on undisturbed and/or remolded samples of the subsurface soils. The test is performed under saturated conditions at loads of 1,000 lbs./sq.ft., 2,000 lbs./sq.ft., and 3,000 lbs./sq.ft. with results shown on Plates A and B.
- 4.8 **Consolidation tests** (ASTM: D 2435) were performed on undisturbed samples to determine the differential and total settlement which may be anticipated based upon the proposed loads. Water was added to the samples at a surcharge of one KSF and the settlement curves are plotted on Plates C to E.

5.0 **Seismicity Evaluation**

The proposed development lies outside of any Alquist Priolo Special Studies Zone and the potential for damage due to direct fault rupture is considered unlikely. The site is situated in an area of high regional seismicity and the Whittier fault is located about 2 kilometers from the site. Ground shaking originating from earthquakes along other active faults in the region is expected to induce lower horizontal accelerations due to smaller anticipated earthquakes and/or greater distances to other faults. The seismic design parameters are provided on the following page and are based on the 2019 California Building Code (CBC) Standard ASCE/SEI 7-16. The data was obtained from the American Society of Civil Engineers (ASCE) website, <https://asce7hazardtool.online/>. The ASCE 7 Hazards Report is attached in Appendix C.

Seismic Design Acceleration Parameters

Latitude	33.973
Longitude	-118.047
Site Class	D
Risk Category	II
Mapped Spectral Response Acceleration	$S_s = 1.837$ $S_1 = 0.655$
Adjusted Maximum Acceleration	$S_{MS} = 1.837$
Design Spectral Response Acceleration Parameters	$S_{DS} = 1.224$
Peak Ground Acceleration	$PGA_M = 0.876$

Use of these values is dependent on requirements of ASCE 7-16, 11-4.8, Exception 2 that requires the value of the seismic response coefficient C_s be determined by Equation 12.8.2 for values of $T \leq 1.5T_s$ and taken as equal to 1.5 times the value computed in accordance with either 12.8-3 for $T_L \geq T \geq 1.5T_s$ or Equation 12.8-4 for $T > T_L$. Computations and verification of these conditions is referred to the structural engineer.

6.0 Liquefaction Evaluation

The site is expected to experience ground shaking and earthquake activity that is typical of Southern California area. It is during severe ground shaking that loose, granular soils below the groundwater table can liquefy. Based upon information in the California Division of Mines and Geology "Seismic Hazard Zone Map – Whittier Quadrangle", dated March 25, 1999, the subject site is not situated in an area of historic occurrence of liquefaction, or local geological, geotechnical and groundwater conditions to indicate a potential for permanent ground displacement. Therefore, the design of the proposed development in conformance with the latest Building Code provisions for earthquake design is expected to provide mitigation of ground shaking hazards that are typical to Southern California.

7.0 Infiltration Characteristics

Infiltration tests within the site were performed to provide preliminary infiltration rates for the purpose of planning and design of an on-site water disposal system. A truck mounted Simco 2800 Drill Rig equipped with a hollow stem auger was used to excavate the exploratory borings to depths ranging between 5 and 10 below existing ground surface. The borings consisted of six-inch diameter test holes. A three-inch diameter perforated PVC casing with solid end cap was installed in the borings and then surrounded with gravel materials to prevent caving.

The infiltration holes were carefully filled with clean water and refilled after two initial readings. Based upon the initial rates of infiltration at each location, test measurements were measured at selected maximum intervals thereafter. Measurements were obtained by using an electronic tape measure with 1/16-inch divisions and timed with a stopwatch. The field infiltration rate was computed using a reduction factor – R_f based on the field measurements with our calculations given in Appendix D. Based upon the results of our testing, the soils encountered in the planned on-site drainage disposal system area exhibit the following infiltration rates.

Boring/Test No.	Depth	Soil Classification	Field Infiltration Rate	Design Rate
B-1/TH-1	5'	Clayey SILT	5.5 in/hr	2.7 in/hr
B-2/TH-2	7.5'	Clayey SILT	1.5 in/hr	0.7 in/hr
B-3/TH-3	10'	Clayey SILT	3.7 in/hr	1.8 in/hr

The correction factors CF_t , CF_v and CF_s are given below based on soils between 5 and 10 feet from our field tests.

- a) $CF_t = R_f = 3.83$ to 5.33 for our three infiltration test holes.
- b) $CF_v = 1.0$ based on uniform soils encountered in two borings for infiltration tests.
- c) $CF_s = 2.0$ for long-term siltation, plugging and maintenance. The subsurface soils are likely to have some plugging and regular maintenance of storm water discharge devices is required.

Based on the results of our field testing, the subsurface soils encountered in the proposed on-site drainage disposal system at 5 to 10 feet below ground surface and into very stiff fine-grained clayey soils which are not suitable for seepage pits at the site. All systems must meet the latest county specifications and the California Regional Water Quality Control Board (CRWQCB) requirements.

It is recommended that foundations shall be setback a minimum distance of 10 feet from the drainage disposal system and the bottom of footing shall be a minimum of 10 feet from the expected zone of saturation. The boundary of the zone of saturation may be assumed to project downward from the top of the permeable portion of the disposal system at an inclination of 1 to 1 or flatter, as determined by the geotechnical engineer.

8.0 Conclusions and Recommendations

Based upon our evaluations, the proposed development is acceptable from a geotechnical engineering standpoint. By following the recommendations and guidelines set forth in our report, the structures will be safe from excessive settlements under the anticipated design loadings and conditions. The proposed development shall meet all requirements of the City Building Ordinance and will not impose any adverse effect on existing adjacent structures.

The following recommendations are based upon soil conditions encountered in our field investigation; these near-surface soil conditions could vary across the site. Variations in the soil conditions may not become evident until the commencement of grading operations for the proposed development and revised recommendations from the soils engineer may be necessary based upon the conditions encountered.

It is recommended that site inspections be performed by a representative of this firm during all grading and construction of the development to verify the findings and recommendations documented in this report. Any unusual conditions which may be encountered in the course of the project development may require the need for additional study and revised recommendations.

8.1 Site Grading Recommendations

Any vegetation and/or demolition debris shall be removed and hauled from proposed grading areas prior to the start of grading operations. Existing vegetation shall not be mixed or disced into the soils. Any removed soils may be reutilized as compacted fill once any deleterious material or oversized materials (in excess of eight inches) is removed. Grading operations shall be performed in accordance with the attached *Specifications for Placement of Compacted Fill*.

8.1.1 **Removal and Recompaction Recommendations**

All disturbed soils and/or fill (about 1 to 6 feet below ground surface) shall be removed to competent native material, the exposed surface scarified to a depth of 12 inches, brought to within 2% of optimum moisture content and compacted to a minimum of 90% of the laboratory standard (ASTM: D 1557) prior to placement of any additional compacted fill soils, foundations, slabs-on-grade and pavement. Grading shall extend a minimum of five horizontal feet outside the edges of foundations or equidistant to the depth of fill placed, whichever is greater.

It is possible that isolated areas of undiscovered fill not described in this report are present on site; if found, these areas should be treated as discussed earlier. A diligent search shall also be conducted during grading operations in an effort to uncover any underground structures, irrigation or utility lines. If encountered, these structures and lines shall be either removed or properly abandoned prior to the proposed construction.

Any imported fill material should be preferably soil similar to the upper soils encountered at the subject site. All soils shall be approved by this firm prior to importing at the site and will be subjected to additional laboratory testing to assure concurrence with the recommendations stated in this report.

If placement of slabs-on-grade and pavement is not completed immediately upon completion of grading operations, additional testing and grading of the areas may be necessary prior to continuation of construction operations. Likewise, if adverse weather conditions occur which may damage the subgrade soils, additional assessment by the soils engineer as to the suitability of the supporting soils may be needed.

Care should be taken to provide or maintain adequate lateral support for all adjacent improvements and structures at all times during the grading operations and construction phase. Adequate drainage away from the structures, pavement and slopes should be provided at all times.

8.1.2 **Fill Blanket Recommendations**

Due to the potential for differential settlement of foundations placed on compacted fill and native materials, it is recommended that all foundations including floor slab areas be underlain by a uniform compacted fill blanket at least two feet in thickness. This fill blanket shall extend a minimum of five horizontal feet outside the edges of foundations or equidistant to the depth of fill placed, whichever is greater.

8.2 **Shrinkage and Subsidence**

Results of our in-place density tests reveal that the soil shrinkage will be less than 10 to 15% due to excavation and recompaction, based upon the assumption that the fill is compacted to 92% of the maximum dry density per ASTM standards. Subsidence should be 0.2 feet due to earthwork operations. The volume change does not include any allowance for vegetation or organic stripping, removal of subsurface improvements, or topographic approximations. Although these values are only approximate, they represent our best estimate of lost yardage, which will likely occur during grading. If more accurate shrinkage and subsidence factors are needed, it is recommended that field testing the actual equipment and grading techniques should be conducted.

8.3 **Temporary Excavations**

Temporary unsurcharged excavations in the existing site materials may be made at vertical inclinations up to 4 feet in height unless cohesionless soils are encountered. In areas where soils with little or no binder are encountered, where adverse geological conditions are exposed, or where excavations are adjacent to existing structures, shoring or flatter excavations may be required. The temporary cut slope gradients given above do not preclude local raveling and sloughing. All excavations shall be made in accordance with the requirements of the soils engineer, CAL-OSHA and other public agencies having jurisdiction. Care should be taken to provide or maintain adequate lateral support for all adjacent improvements and structures at all times during the grading operations and construction phase. Additional recommendations regarding specific excavations may be calculated once typical detail sections are made available.

8.4 Foundation Design

All foundations may be designed utilizing the following allowable bearing capacities for an embedded depth of 24 inches into approved engineered fill with the corresponding widths:

Allowable Bearing Capacity (psf)		
Width (feet)	Continuous Foundation	Isolated Foundation
1.5	2000	2500
2.0	2075	2575
4.0	2375	2875
6.0	2500	3000

The bearing value may be increased by 500 psf for each additional foot of depth in excess of the 24-inch minimum depth, up to a maximum of 4,000 psf. A one-third increase may be used when considering short-term loading and seismic forces. Any foundations located along property line may utilize an allowable bearing capacity of 1,500 psf and embedded into competent native soils. All foundations shall be reinforced a minimum of one, No. 4 bar, top and bottom. A representative of this firm shall inspect all foundation excavations prior to pouring concrete.

8.5 Settlement Analysis

Resultant pressure curves for the consolidation tests are shown on Plates C to E. Computations utilizing these curves and the recommended allowable soil bearing capacities reveal that the foundations will experience settlements on the order of 3/4 inch and differential settlements of less than 1/4 inch.

8.6 Lateral Resistance

The following values may be utilized in resisting lateral loads imposed on the structure. Requirements of the California Building Code should be adhered to when the coefficient of friction and passive pressures are combined.

Coefficient of Friction - 0.35

Equivalent Passive Fluid Pressure = 200 lbs./cu.ft.

Maximum Passive Pressure = 2,000 lbs./cu.ft.

The passive pressure recommendations are valid only for approved compacted fill soils or competent native materials.

8.7 Retaining Wall Design Parameters

Active earth pressures against retaining walls will be equal to the pressures developed by the following fluid densities. These values are for **approved granular backfill material** placed behind the walls at various ground slopes above the walls.

Surface Slope of Retained Materials (Horizontal to Vertical)	Equivalent Fluid Density (lb./cu.ft.)
Level	30
5 to 1	35
4 to 1	38
3 to 1	40
2 to 1	45

Any applicable short-term construction surcharges and seismic forces should be added to the above lateral pressure values. An equivalent fluid pressure of 45 pcf may be utilized for the restrained wall condition with a level grade behind the wall.

The seismic-induced lateral soil pressure for walls greater than 6 feet may be computed using a triangular pressure distribution with the maximum value at the top of the wall. The maximum lateral pressure of (20 pcf) H where H is the height of the retained soils above the wall footing should be used in final design of retaining walls. Sliding resistance values and passive fluid pressure values may be increased by 1/3 during short-term wind and seismic loading conditions.

All walls shall be waterproofed as needed and protected from hydrostatic pressure by a reliable permanent subdrain system. The granular backfill to be utilized immediately adjacent to retaining walls shall consist of an approved select granular soil with a sand equivalency greater than 30. This backfill zone of free draining material shall consist of a wedge beginning a minimum of one horizontal foot from the base of the wall extending upward at an inclination of no less than $\frac{3}{4}$ to 1 (horizontal to vertical).

8.8 **Slab Design**

All concrete slabs shall be a minimum of six inches in thickness in the proposed warehouse areas and four inches in office and hardscape both reinforced a minimum of No. 4 bars, sixteen inches in each direction and positioned in the center of slab and placed on approved subgrade soils. Additional reinforcement requirements and an increase in thickness of the slabs-on-grade may be necessary based upon soils expansion potential and proposed loading conditions in the structures and should be evaluated further by the project engineers and/or architect. All subgrade soils shall be moisture conditioned to 3% over optimum moisture content to a depth eighteen inches.

A vapor retarder (10-mil minimum thickness) should be utilized in areas which would be sensitive to the infiltration of moisture. This retarder shall meet requirements of ASTM E 96, *Water Vapor Transmission of Materials* and ASTM E 1745, *Standard Specification for Water Vapor Retarders used in Contact with Soil or Granular Fill Under Concrete Slabs*. The vapor retarder shall be installed in accordance with procedures stated in ASTM E 1643, *Standard practice for Installation of Water Vapor Retarders used in Contact with Earth or Granular Fill Under Concrete Slabs*.

The moisture retarder may be placed directly upon compacted subgrade soils conditioned to near optimum moisture levels, although one to two inches of sand beneath the membrane is desirable. The subgrade upon which the retarder is placed shall be smooth and free of rocks, gravel or other protrusions which may damage the retarder. Use of sand above the retarder is under the purview of the structural engineer; if sand is used over the retarder, it should be placed in a dry condition.

8.9 **Pavement Section Design**

The table on the following page provides a preliminary pavement design based upon an R-Value of 7 for the subgrade soils for the proposed pavement areas. Final pavement design may need to be based on R-Value testing of the subgrade soils near the conclusion of site grading to assure that these soils are consistent with those assumed in this preliminary design.

The recommendations are based upon estimated traffic loads. Client should submit any other anticipated traffic loadings to the geotechnical engineer, if necessary, so that pavement sections may be reviewed to determine adequacy to support the proposed loadings.

Type of Traffic	Traffic Index	Asphalt (in.)	Base Material (in.)
Automobile Parking Stalls	4.0	3.0	7.0
Light Vehicle Circulation Areas	6.0	4.0	12.0
Heavy Truck Access Areas	7.0	4.5	16.0

Any concrete slab-on-grade in pavement areas shall be a minimum of seven inches in thickness and may be placed on approved subgrade soils. All pavement areas shall have positive drainage toward an approved outlet from the site. Drain lines behind curbs and/or adjacent to landscape areas should be considered by client and the appropriate design engineers to prevent water from infiltrating beneath pavement. If such infiltration occurs, damage to pavement, curbs and flow lines, especially on sites with expansive soils, may occur during the life of the project.

Any approved base material shall consist of a Class II aggregate or equivalent and should be compacted to a minimum of 95% relative compaction. All pavement materials shall conform to the requirements set forth by the City of Whittier. The base material; and asphaltic concrete should be tested prior to delivery to the site and during placement to determine conformance with the project specifications. A pavement engineer shall designate the specific asphalt mix design to meet the required project specifications.

8.10 Utility Trench and Excavation Backfill

Trenches from installation of utility lines and other excavations may be backfilled with on-site soils or approved imported soils compacted to a minimum of 90% relative compaction. All utility lines shall be properly bedded with clean sand having a sand equivalency rating of 30 or more. This bedding material shall be thoroughly water jetted around the pipe structure prior to placement of compacted backfill soils.

8.11 Corrosion Design Criteria

Representative samples of the surficial soils, typical of the subgrade soils expected to be encountered within foundation excavations and underground utilities were tested for corrosion potential. The minimum resistivity value obtained for the samples tested is representative of an environment that may be severely corrosive to metals. The soil pH value was considered mildly alkaline and may not have a significant effect on soil corrosivity. Consideration should be given to corrosion protection systems for buried metal such as protective coatings, wrappings or the use of PVC where permitted by local building codes.

According to Table 4.3.1 of ACI 318 Building Code and Commentary, these contents revealed negligible sulfate concentrations. Therefore, a Type II cement according to latest CBC specifications may be utilized for building foundations at this time. It is recommended that additional sulfate tests be performed at the completion of site grading to assure that the as graded conditions are consistent with the recommendations stated in this design. Corrosion test results may be found on the attached Table IV.

8.12 Expansive Soil

Since expansive soils were encountered, special attention should be given to the project design and maintenance. The attached *Expansive Soil Guidelines* should be reviewed by the engineers, architects, owner, maintenance personnel and other interested parties and considered during the design of the project and future property maintenance.

9.0 Closure

The recommendations and conclusions contained in this report are based upon the soil conditions uncovered in our test excavations. No warranty of the soil condition between our excavations is implied. NorCal Engineering should be notified for possible further recommendations if unexpected to unfavorable conditions are encountered during construction phase.

It is the responsibility of the owner to ensure that all information within this report is submitted to the Architect and appropriate Engineers for the project. A preconstruction conference should be held between the developer, general contractor, grading contractor, city inspector, architect, and geotechnical engineer to clarify any questions relating to the grading operations and subsequent construction. Our representative should be present during the grading operations and construction phase to certify that such recommendations are complied within the field.

This geotechnical investigation has been conducted in a manner consistent with the level of care and skill exercised by members of our profession currently practicing under similar conditions in the Southern California area. No other warranty, expressed or implied is made.

We appreciate this opportunity to be of service to you. If you have any further questions, please do not hesitate to contact the undersigned.

Respectfully submitted,
NORCAL ENGINEERING


Keith D. Tucker
Project Engineer
R.G.E. 841




Scott D. Spensiero
Project Manager

SPECIFICATIONS FOR PLACEMENT OF COMPACTED FILL

Excavation

Any existing low-density soils and/or saturated soils shall be removed to competent natural soil under the inspection of the Geotechnical Engineering Firm. After the exposed surface has been cleansed of debris and/or vegetation, it shall be scarified until it is uniform in consistency, brought to the proper moisture content and compacted to a minimum of 90% relative compaction (in accordance with ASTM: D 1557).

In any area where a transition between fill and native soil or between bedrock and soil are encountered, additional excavation beneath foundations and slabs will be necessary in order to provide uniform support and avoid differential settlement of the structure.

Material for Fill

The on-site soils or approved import soils may be utilized for the compacted fill provided they are free of any deleterious materials and shall not contain any rocks, brick, asphaltic concrete, concrete or other hard materials greater than eight inches in maximum dimensions. Any import soil must be approved by the Geotechnical Engineering firm a minimum of 72 hours prior to importation of site.

Placement of Compacted Fill Soils

The approved fill soils shall be placed in layers not excess of six inches in thickness. Each lift shall be uniform in thickness and thoroughly blended. The fill soils shall be brought to within 2% of the optimum moisture content, unless otherwise specified by the Soils Engineering firm. Each lift shall be compacted to a minimum of 90% relative compaction (in accordance with ASTM: D 1557) and approved prior to the placement of the next layer of soil. Compaction tests shall be obtained at the discretion of the Geotechnical Engineering firm but to a minimum of one test for every 500 cubic yards placed and/or for every 2 feet of compacted fill placed.

The minimum relative compaction shall be obtained in accordance with accepted methods in the construction industry. The final grade of the structural areas shall be in a dense and smooth condition prior to placement of slabs-on-grade or pavement areas. No fill soils shall be placed, spread or compacted during unfavorable weather conditions. When the grading is interrupted by heavy rains, compaction operations shall not be resumed until approved by the Geotechnical Engineering firm.

Grading Observations

The controlling governmental agencies should be notified prior to commencement of any grading operations. This firm recommends that the grading operations be conducted under the observation of a Soils Engineering firm as deemed necessary. A 24-hour notice must be provided to this firm prior to the time of our initial inspection.

Observation shall include the clearing and grubbing operations to assure that all unsuitable materials have been properly removed; approve the exposed subgrade in areas to receive fill and in areas where excavation has resulted in the desired finished grade and designate areas of overexcavation; and perform field compaction tests to determine relative compaction achieved during fill placement. In addition, all foundation excavations shall be observed by the Geotechnical Engineering firm to confirm that appropriate bearing materials are present at the design grades and recommend any modifications to construct footings.

EXPANSIVE SOIL GUIDELINES

The following expansive soil guidelines are provided for your project. The intent of these guidelines is to inform you, the client, of the importance of proper design and maintenance of projects supported on expansive soils. ***You, as the owner or other interested party, should be warned that you have a duty to provide the information contained in the soil report including these guidelines to your design engineers, architects, landscapers and other design parties in order to enable them to provide a design that takes into consideration expansive soils.***

In addition, you should provide the soil report with these guidelines to any property manager, lessee, property purchaser or other interested party that will have or assume the responsibility of maintaining the development in the future.

Expansive soils are fine-grained silts and clays which are subject to swelling and contracting. The amount of this swelling and contracting is subject to the amount of fine-grained clay materials present in the soils and the amount of moisture either introduced or extracted from the soils. Expansive soils are divided into five categories ranging from "very low" to "very high". Expansion indices are assigned to each classification and are included in the laboratory testing section of this report. *If the expansion index of the soils on your site, as stated in this report, is 21 or higher, you have expansive soils.* The classifications of expansive soils are as follows:

Classification of Expansive Soil*

Expansion Index	Potential Expansion
0-20	Very Low
21-50	Low
51-90	Medium
91-130	High
Above 130	Very High

*From Table 18A-I-B of California Building Code (1988)

When expansive soils are compacted during site grading operations, care is taken to place the materials at or slightly above optimum moisture levels and perform proper compaction operations. Any subsequent excessive wetting and/or drying of expansive soils will cause the soil materials to expand and/or contract. These actions are likely to cause distress of foundations, structures, slabs-on-grade, sidewalks and pavement over the life of the structure. ***It is therefore imperative that even after construction of improvements, the moisture contents are maintained at relatively constant levels, allowing neither excessive wetting or drying of soils.***


Evidence of excessive wetting of expansive soils may be seen in concrete slabs, both interior and exterior. Slabs may lift at construction joints producing a trip hazard or may crack from the pressure of soil expansion. Wet clays in foundation areas may result in lifting of the structure causing difficulty in the opening and closing of doors and windows, as well as cracking in exterior and interior wall surfaces. In extreme wetting of soils to depth, settlement of the structure may eventually result. Excessive wetting of soils in landscape areas adjacent to concrete or asphaltic pavement areas may also result in expansion of soils beneath pavement and resultant distress to the pavement surface.

Excessive drying of expansive soils is initially evidenced by cracking in the surface of the soils due to contraction. Settlement of structures and on-grade slabs may also eventually result along with problems in the operation of doors and windows.

Projects located in areas of expansive clay soils will be subject to more movement and "hairline" cracking of walls and slabs than similar projects situated on non-expansive sandy soils. There are, however, measures that developers and property owners may take to reduce the amount of movement over the life the development. The following guidelines are provided to assist you in both design and maintenance of projects on expansive soils:

- Drainage away from structures and pavement is essential to prevent excessive wetting of expansive soils. Grades should be designed to the latest building code and maintained to allow flow of irrigation and rain water to approved drainage devices or to the street. Any “ponding” of water adjacent to buildings, slabs and pavement after rains is evidence of poor drainage; the installation of drainage devices or regrading of the area may be required to assure proper drainage. Installation of rain gutters is also recommended to control the introduction of moisture next to buildings. Gutters should discharge into a drainage device or onto pavement which drains to roadways.
- Irrigation should be strictly controlled around building foundations, slabs and pavement and may need to be adjusted depending upon season. This control is essential to maintain a relatively uniform moisture content in the expansive soils and to prevent swelling and contracting. Over-watering adjacent to improvements may result in damage to those improvements. NorCal Engineering makes no specific recommendations regarding landscape irrigation schedules.
- Planting schemes for landscaping around structures and pavement should be analyzed carefully. Plants (including sod) requiring high amounts of water may result in excessive wetting of soils. Trees and large shrubs may actually extract moisture from the expansive soils, thus causing contraction of the fine-grained soils.
- Thickened edges on exterior slabs will assist in keeping excessive moisture from entering directly beneath the concrete. A six-inch thick or greater deepened edge on slabs may be considered. Underlying interior and exterior slabs with 6 to 12 inches, or more of non-expansive soils and providing presaturation of the underlying clayey soils as recommended in the soil report will improve the overall performance of on-grade slabs.

- Increase the amount of steel reinforcing in concrete slabs, foundations and other structures to resist the forces of expansive soils. The precise amount of reinforcing should be determined by the appropriate design engineers and/or architects.
- Recommendations of the soil report should always be followed in the development of the project. Any recommendations regarding presaturation of the upper subgrade soils in slab areas should be performed in the field and verified by the Soil Engineer.

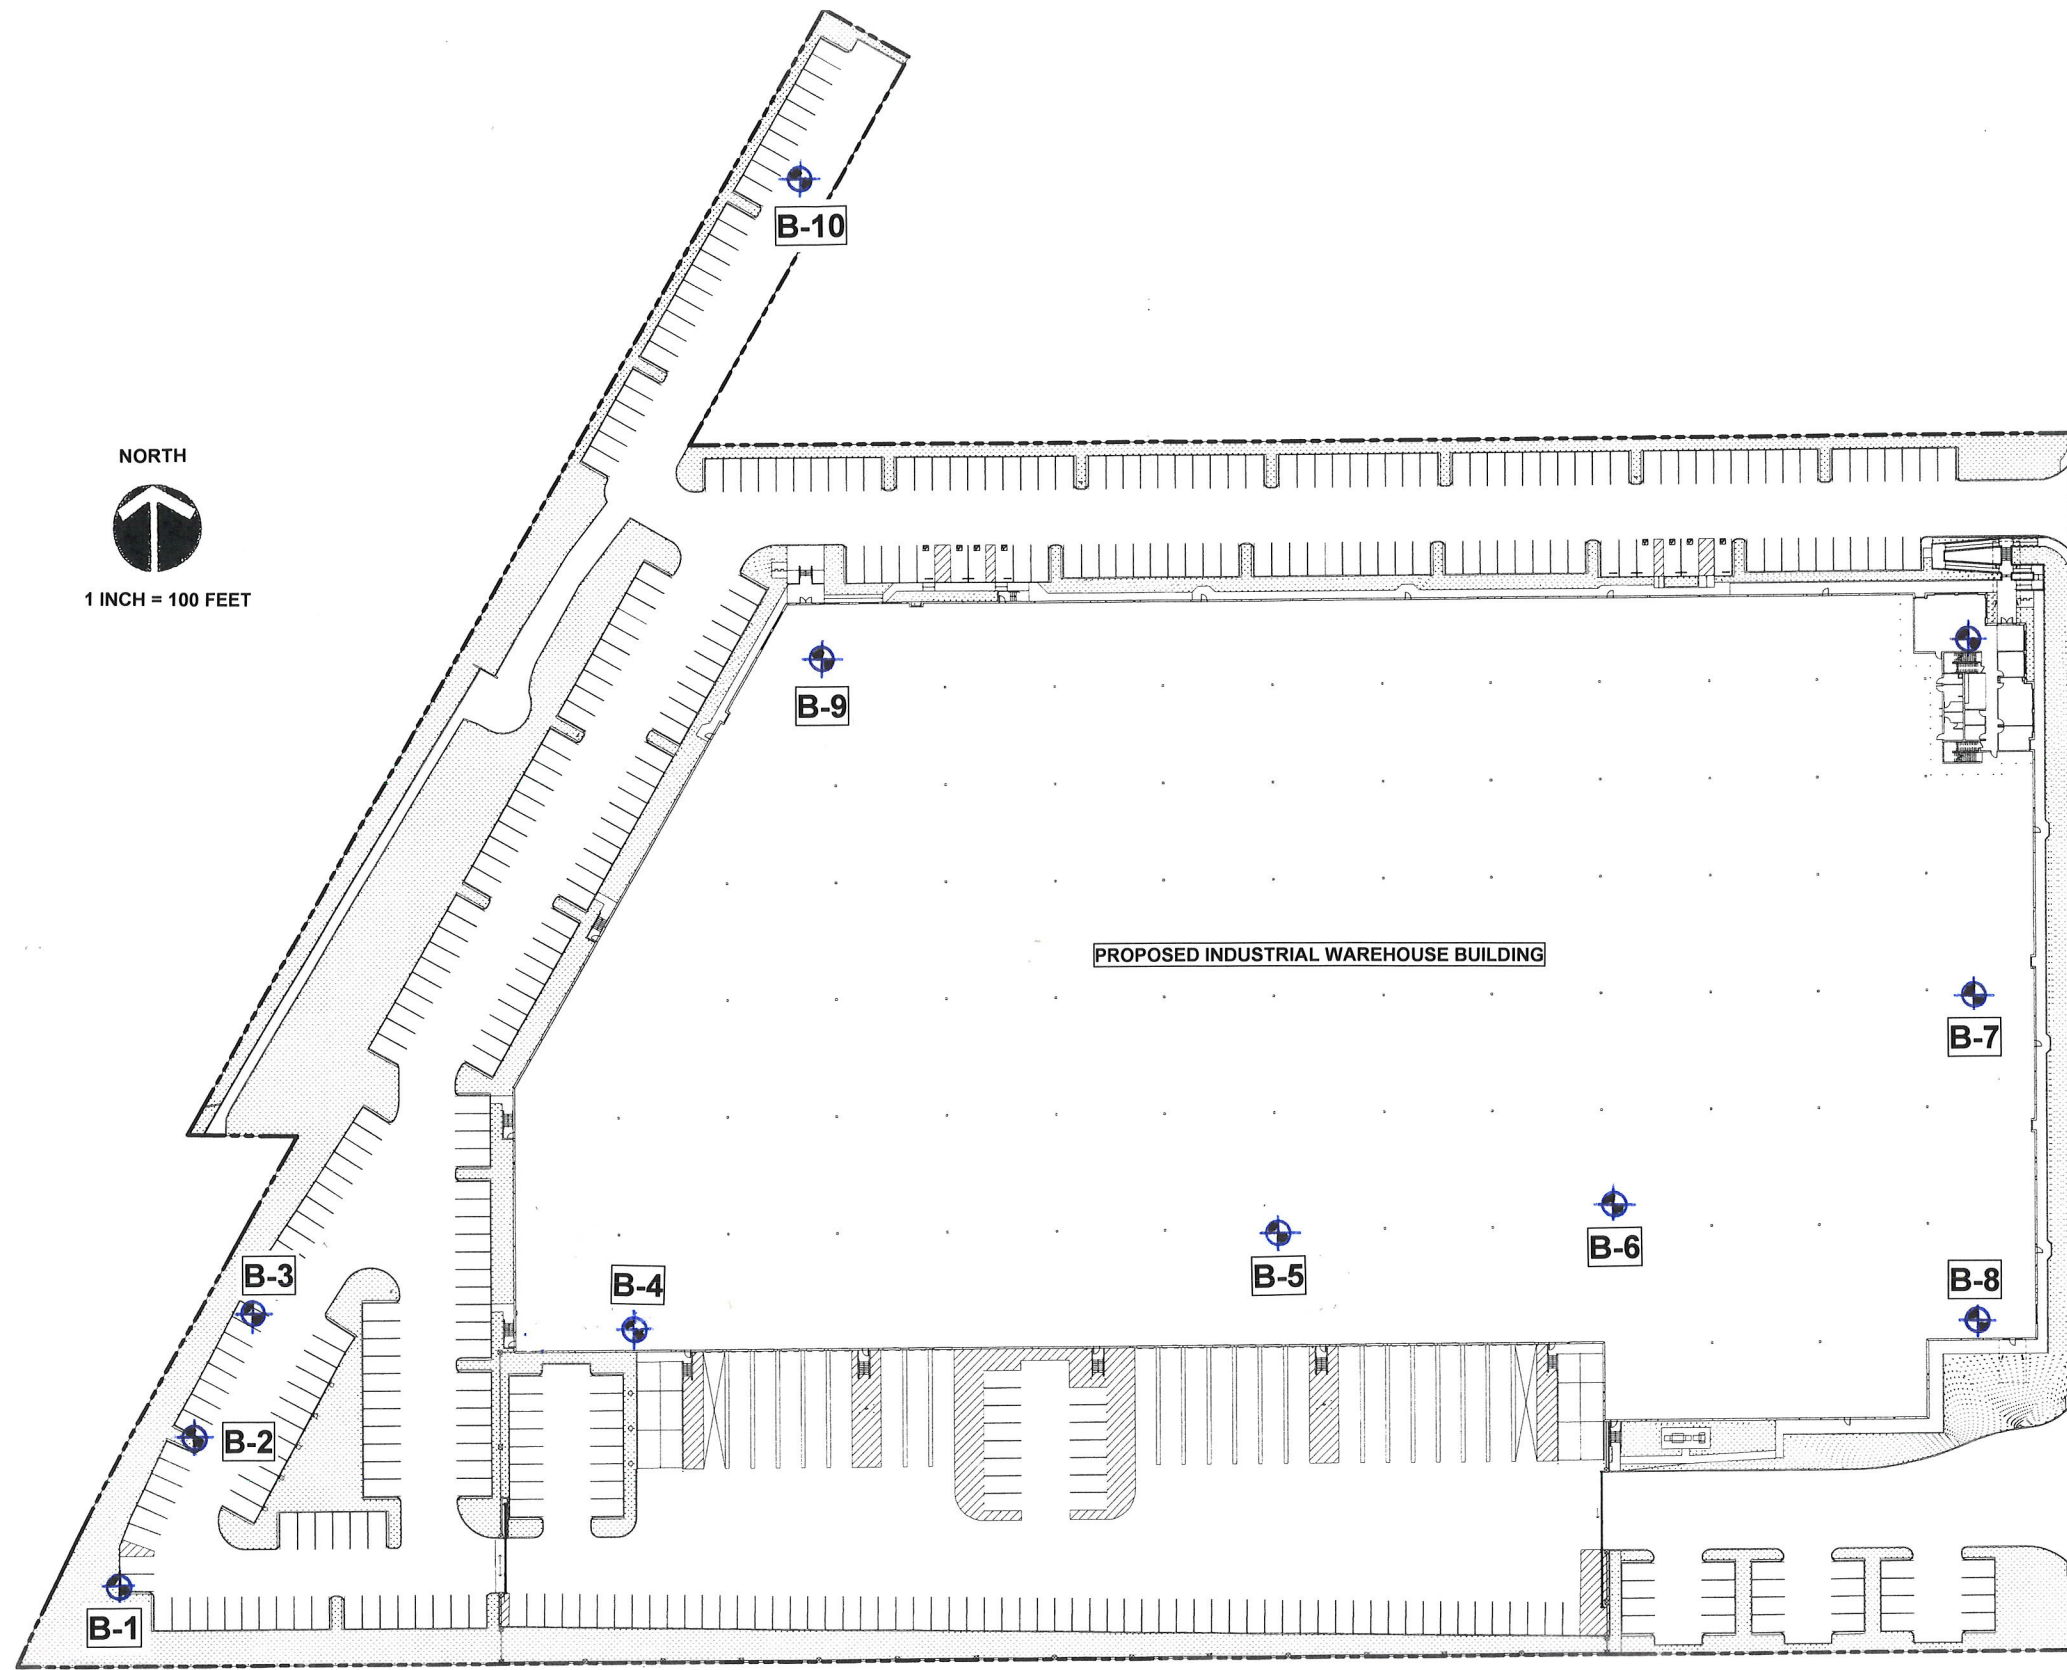

WHITTIER BOULEVARD

PROPOSED INDUSTRIAL WAREHOUSE BUILDING

NORTH
1 INCH = 100 FEET

NorCal Engineering	
SOILS AND GEOTECHNICAL CONSULTANTS	
PROJECT 22416-21	DATE JUNE 2023

SITE PLAN

List of Appendices **(in order of appearance)**

Appendix A – Log of Excavations

Log of Borings B-1 to B-11

Appendix B – Laboratory Tests

Table I – Maximum Dry Density

Table II – Expansion

Table III – Atterberg Limits

Table IV - Corrosion

Plates A and B – Direct Shear

Plates C to E - Consolidation

Appendix C –ASCE Seismic Hazards Report and Maps

ASCE Seismic Hazards Report

Appendix D – Soil Infiltration Data

Appendix A

MAJOR DIVISION			GRAPHIC SYMBOL	LETTER SYMBOL	TYPICAL DESCRIPTIONS	
COARSE GRAINED SOILS	GRAVEL AND GRAVELLY SOILS	CLEAN GRAVELS (LITTLE OR NO FINES)		GW	WELL-GRADED GRAVELS, GRAVEL-SAND MIXTURES, LITTLE OR NO FINES	
				GP	POORLY-GRADED GRAVELS, GRAVEL-SAND MIXTURES, LITTLE OR NO FINES	
		GRAVELS WITH FINES (APPRECIABLE AMOUNT OF FINES)		GM	SILTY GRAVELS, GRAVEL-SAND-SILT MIXTURES	
	MORE THAN 50% OF COARSE FRACTION RETAINED ON NO. 4 SIEVE			GC	CLAYEY GRAVELS, GRAVEL-SAND-CLAY MIXTURES	
				SW	WELL-GRADED SANDS, GRAVELLY SANDS, LITTLE OR NO FINES	
	SAND AND SANDY SOILS	CLEAN SAND (LITTLE OR NO FINES)		SP	POORLY-GRADED SANDS, GRAVELLY SANDS, LITTLE OR NO FINES	
		MORE THAN 50% OF COARSE FRACTION PASSING ON NO. 4 SIEVE	SANDS WITH FINE (APPRECIABLE AMOUNT OF FINES)		SM	SILTY SANDS, SAND-SILT MIXTURES
					SC	CLAYEY SANDS, SAND-CLAY MIXTURES
FINE GRAINED SOILS	SILTS AND CLAYS	LIQUID LIMIT LESS THAN 50		ML	INORGANIC SILTS AND VERY FINE SANDS, ROCK FLOUR, SILTY OR CLAYEY FINE SANDS OR CLAYEY SILTS WITH SLIGHT PLASTICITY	
				CL	INORGANIC CLAYS OF LOW TO MEDIUM PLASTICITY, GRAVELLY CLAYS, SANDY CLAYS, SILTY CLAYS, LEAN CLAYS	
				OL	ORGANIC SILTS AND ORGANIC SILTY CLAYS OF LOW PLASTICITY	
	MORE THAN 50% OF MATERIAL IS SMALLER THAN NO. 200 SIEVE SIZE	SILTS AND CLAYS	LIQUID LIMIT GREATER THAN 50		MH	INORGANIC SILTS, MICACEOUS OR DIATOMACEOUS FINE SAND OR SILTY SOILS
					CH	INORGANIC CLAYS OF HIGH PLASTICITY, FAT CLAYS
					OH	ORGANIC CLAYS OF MEDIUM TO HIGH PLASTICITY, ORGANIC SILTS
					PT	PEAT, HUMUS, SWAMP SOILS WITH HIGH ORGANIC CONTENTS
HIGHLY ORGANIC SOILS						

NOTE: DUAL SYMBOLS ARE USED TO INDICATE BORDERLINE SOIL CLASSIFICATIONS

UNIFIED SOIL CLASSIFICATION SYSTEM

KEY:

- Indicates 2.5-inch Inside Diameter. Ring Sample.
- ⊗ Indicates 2-inch OD Split Spoon Sample (SPT).
- Indicates Shelby Tube Sample.
- Indicates No Recovery.
- Indicates SPT with 140# Hammer 30 in. Drop.
- ☑ Indicates Bulk Sample.
- ☑ Indicates Small Bag Sample.
- Indicates Non-Standard
- ⊗ Indicates Core Run.

COMPONENT DEFINITIONS

COMPONENT	SIZE RANGE
Boulders	Larger than 12 in
Cobbles	3 in to 12 in
Gravel	3 in to No 4 (4.5mm)
Coarse gravel	3 in to 3/4 in
Fine gravel	3/4 in to No 4 (4.5mm)
Sand	No. 4 (4.5mm) to No. 200 (0.074mm)
Coarse sand	No. 4 (4.5 mm) to No. 10 (2.0 mm)
Medium sand	No. 10 (2.0 mm) to No. 40 (0.42 mm)
Fine sand	No. 40 (0.42 mm) to No. 200 (0.074 mm)
Silt and Clay	Smaller than No. 200 (0.074 mm)

COMPONENT PROPORTIONS

DESCRIPTIVE TERMS	RANGE OF PROPORTION
Trace	1 - 5%
Few	5 - 10%
Little	10 - 20%
Some	20 - 35%
And	35 - 50%

MOISTURE CONTENT

DRY	Absence of moisture, dusty, dry to the touch.
DAMP	Some perceptible moisture; below optimum
MOIST	No visible water; near optimum moisture content
WET	Visible free water, usually soil is below water table.

RELATIVE DENSITY OR CONSISTENCY VERSUS SPT N -VALUE

COHESIONLESS SOILS		COHESIVE SOILS		
Density	N (blows/ft)	Consistency	N (blows/ft)	Approximate Undrained Shear Strength (psf)
Very Loose	0 to 4	Very Soft	0 to 2	< 250
Loose	4 to 10	Soft	2 to 4	250 - 500
Medium Dense	10 to 30	Medium Stiff	4 to 8	500 - 1000
Dense	30 to 50	Stiff	8 to 15	1000 - 2000
Very Dense	over 50	Very Stiff	15 to 30	2000 - 4000
		Hard	over 30	> 4000

Boring Location: 12352 Whittier Blvd., Whittier

Date of Drilling: 3/22/2021


Groundwater Depth: None Encountered

Drilling Method: Simco 2800HS

Hammer Weight: 140 lbs

Drop: 30"

Surface Elevation: Not Measured

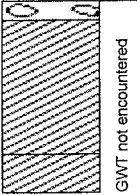Depth (feet)	Lithology	Material Description	Samples		Laboratory		
			Type	Blow Counts	Moisture	DRY Density	Fines Content %
0		Base Material					
		FILL Clayey SILT Brown, firm to stiff, moist; with occasional gravel and some cobbles					
5		NATURAL Clayey SILT Brown, firm to stiff, moist Boring completed at depth of 5'					
10							
15							
20							
25							
30							
35							

Boring Location: 12352 Whittier Blvd., Whittier

Date of Drilling: 3/22/2021


Groundwater Depth: None Encountered

Drilling Method: Simco 2800HS

Hammer Weight: 140 lbs

Drop: 30"

Surface Elevation: Not Measured

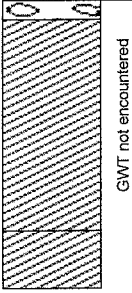Depth (feet)	Lithology	Material Description	Samples		Laboratory		
			Type	Blow Counts	Moisture	Dry Density	Fines Content %
0		Base Material					
5		FILL Clayey SILT Brown, firm to stiff, moist; with occasional gravel and some cobbles					
10		NATURAL Clayey SILT Brown, firm to stiff, moist Boring completed at depth of 7.5'					
15							
20							
25							
30							
35							

Boring Location: 12352 Whittier Blvd., Whittier

Date of Drilling: 3/22/2021

Groundwater Depth: None Encountered


Drilling Method: Simco 2800HS

Hammer Weight: 140 lbs

Drop: 30"

Surface Elevation: Not Measured

Depth (feet)	Lithology	Material Description	Samples		Laboratory		
			Type	Blow Counts	Moisture	DY Density	Fines Content %
0		Asphalt Pavement					
		FILL					
		Clayey SILT					
		Brown, firm to stiff, moist; with occasional gravel					
5		NATURAL					
		Clayey SILT					
		Brown, firm to stiff, moist					
10		Boring completed at depth of 10'					
15							
20							
25							
30							
35							



GWT not encountered

Boring completed at depth of 10'

Boring Location: 12352 Whittier Blvd., Whittier

Date of Drilling: 3/22/2021

Groundwater Depth: None Encountered

Drilling Method: Simco 2800HS

Hammer Weight: 140 lbs

Drop: 30"

Surface Elevation: Not Measured

Depth (feet)	Lithology	Material Description	Samples		Laboratory		
			Type	Blow Counts	Moisture	Dry Density	Fines Content %
0		Asphalt Pavement					
		FILL					
		Clayey SILT					
		Brown, firm to stiff, moist; with occasional gravel	█	6/6	17.6	107.1	
			█				
5		NATURAL					
		Clayey SILT					
		Brown, firm to stiff, moist	█	5/7	14.9	105.1	
			█				
		Sandy SILT					
		Grey-brown, firm, moist; slightly clayey to clayey	█	3/3	11.8	93.5	
			█				
10							
15							
		Silty CLAY					
		Dark brown, stiff, moist	█	10/14	15.3	110.6	
			█				
20							
25							
			█	16/18	23.1	107.5	
			█				
30							
35							

SuperLog CivilTech Software, USA www.civiltech.com File: C:\Superlog4\PROJECT\22416-21.log Date: 3/31/2021

GWT not encountered

Boring completed at depth of 26'

Boring Location: 12352 Whittier Blvd., Whittier

Date of Drilling: 3/22/2021

Groundwater Depth: None Encountered


Drilling Method: Simco 2800HS

Hammer Weight: 140 lbs

Drop: 30"

Surface Elevation: Not Measured

Depth (feet)	Lithology	Material Description	Samples		Laboratory		
			Type	Blow Counts	Moisture	DY Density	Fines Content %
0		Asphalt Pavement					
		FILL					
		Clayey SILT					
		Brown, firm to stiff, moist; with occasional gravel					
		NATURAL					
		Clayey SILT					
5		Brown, firm to stiff, moist	█	4/5	15.7	102.3	
		Sandy SILT		3/4	10.8	101.0	
		Brown, firm, moist; slightly clayey to clayey					
10		Boring completed at depth of 10'	█	3/5	17.5	99.5	
15							
20							
25							
30							
35							

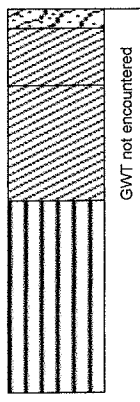

SuperLog CivilTech Software, USA www.civiltech.com File: C:\Superlog4\PROJECT\22416-21.log Date: 3/31/2021

Boring Location: 12352 Whittier Blvd., Whittier

Date of Drilling: 3/22/2021

Groundwater Depth: None Encountered

Drilling Method: Simco 2800HS

Hammer Weight: 140 lbs

Drop: 30"

Surface Elevation: Not Measured

Depth (feet)	Lithology	Material Description	Samples		Laboratory		
			Type	Blow Counts	Moisture	Dry Density	Fines Content %
0		Asphalt Pavement					
		FILL					
		Clayey SILT					
		Brown, firm, moist; with occasional gravel					
		NATURAL					
5		Clayey SILT	■	4/5	18.7	101.7	
		Brown, firm, moist					
10			■	4/4	17.5	96.9	
		Boring completed at depth of 10'					
15							
20							
25							
30							
35							

Boring Location: 12352 Whittier Blvd., Whittier

Date of Drilling: 3/22/2021

Groundwater Depth: None Encountered


Drilling Method: Simco 2800HS

Hammer Weight: 140 lbs

Drop: 30"

Surface Elevation: Not Measured

Depth (feet)	Lithology	Material Description	Samples		Laboratory		
			Type	Blow Counts	Moisture	Dry Density	Fines Content %
0		Asphalt Pavement					
		FILL					
		Clayey SILT					
		Brown, firm to stiff, moist; with occasional gravel					
		NATURAL					
		Clayey SILT					
		Brown, firm, moist; slioghtly sandy	■	6/9	15.4	100.3	
		Sandy SILT	■	3/4	21.2	97.9	
		Grey-brown, firm, moist; slightly clayey					
15		Boring completed at depth of 15'					



Boring Location: 12352 Whittier Blvd., Whittier

Date of Drilling: 3/22/2021


Groundwater Depth: None Encountered

Drilling Method: Simco 2800HS

Hammer Weight: 140 lbs

Drop: 30"

Surface Elevation: Not Measured

Depth (feet)	Lithology	Material Description	Samples		Laboratory		
			Type	Blow Counts	Moisture	Dry Density	Fines Content %
0	 GWT not encountered	FILL Clayey SILT Brown, firm, moist; with occasional gravel					
5		NATURAL Clayey SILT Brown, firm to stiff, moist	■	5/5	16.0	100.1	
10		Boring completed at depth of 10'	■	6/9	14.9	106.3	
15							
20							
25							
30							
35							

Boring Location: 12352 Whittier Blvd., Whittier

Date of Drilling: 3/22/2021

Groundwater Depth: None Encountered


Drilling Method: Simco 2800HS

Hammer Weight: 140 lbs

Drop: 30"

Surface Elevation: Not Measured

Depth (feet)	Lithology	Material Description	Samples		Laboratory		
			Type	Blow Counts	Moisture	Dry Density	Fines Content %
0		Asphalt Pavement					
		FILL					
		Clayey SILT					
		Brown, firm to stiff, moist; with occasional gravel					
5		NATURAL					
		Clayey SILT	■	4/7	16.3	104.1	
		Brown, firm to stiff, moist					
		Silty CLAY					
		Dark brown, stiff, moist					
10		Boring completed at depth of 10'	■	7/9	15.3	104.5	
15							
20							
25							
30							
35							



GWT not encountered

Date: 3/31/2021
File: C:\Superlog4\PROJECT\22416-21.log
SuperLog CivilTech Software, USA www.civilttech.com

Boring Location: 12352 Whittier Blvd., Whittier

Date of Drilling: 3/22/2021

Groundwater Depth: None Encountered

Drilling Method: Simco 2800HS

Hammer Weight: 140 lbs

Drop: 30"

Surface Elevation: Not Measured

Depth (feet)	Lithology	Material Description	Samples		Laboratory		
			Type	Blow Counts	Moisture	Dry Density	Fines Content %
0		Asphalt Pavement / Base Material					
		FILL					
		Clayey SILT					
		Brown, firm to stiff, moist; with occasional gravel	█	4/5	17.3	102.1	
		NATURAL	▣				
		Silty CLAY					
		Brown, firm to stiff, moist	█	4/6	17.5	102.5	
10		Boring completed at depth of 10'	█	8/13	12.9	97.7	



Boring Location: 12352 Whittier Blvd., Whittier

Date of Drilling: 3/22/2021

Groundwater Depth: None Encountered

Drilling Method: Simco 2800HS

Hammer Weight: 140 lbs

Drop: 30"

Surface Elevation: Not Measured

Depth (feet)	Lith-ology	Material Description	Samples		Laboratory		
			Type	Blow Counts	Moisture	DRY Density	Fines Content %
0		Asphalt Pavement					
		FILL					
		Clayey SILT					
		Brown, firm, moist; with occasional gravel	█	5/5	17.3	102.6	
		NATURAL					
		Clayey SILT					
		Brown, firm to stiff, moist	█	5/6	13.1	102.5	
5							
10							
			█	7/9	12.9	104.1	
15							
			█	5/8	15.0	103.0	
20							
25							
30							
35							

Appendix B

TABLE I
MAXIMUM DENSITY TESTS

Sample	Classification	Optimum Moisture (%)	Maximum Dry Density (lbs/cu.ft)
B-4 @ 2'	Clayey SILT	14.0	118.0
B-11 @ 2'	Clayey SILT	14.5	115.0

TABLE II
EXPANSION TESTS

Sample	Classification	Expansion Index
B-4 @ 2'	Clayey SILT	68
B-11 @ 2'	Clayey SILT	74

TABLE III
ATTERBERG LIMITS

Sample	Liquid Limit	Plastic Limit	Plasticity Index
B-4 @ 5'	33	21	12
B-4 @ 10'	28	21	7

TABLE IV
CORROSION TESTS

Sample	pH	Electrical Resistivity	Sulfate (%)	Chloride (ppm)
B-4 @ 2'	7.2	1,760	0.005	289

% by weight
ppm – mg/kg






R-VALUE TEST REPORT

CT-301 ASTM-D2844

PROJECT NAME:	Norcal Western RealCo 22416-21	PROJECT NUMBER:	L-210301
SAMPLE LOCATION:	12352 Whittier Blvd., Whittier, CA	SAMPLE NUMBER:	B1
SAMPLE DESCRIPTION:	SANDY-SILTY CLAY (CL), brown	SAMPLE DEPTH:	2'
SAMPLED BY:	Norcal JS 3/22/21	TESTED BY:	ER
		DATE TESTED:	3/29/2021

TEST SPECIMEN	A	B	C
MOISTURE AT COMPACTION %	22.8	19.3	15.7
WEIGHT OF SAMPLE, grams	1002	1076	922
HEIGHT OF SAMPLE, Inches	2.51	2.56	2.28
DRY DENSITY, pcf	98.6	106.8	105.9
COMPACTOR AIR PRESSURE, psi	80	110	250
EXUDATION PRESSURE, psi	200	329	702
EXPANSION, Inches x 10exp-4	0	4	27
STABILITY Ph 2,000 lbs (160 psi)	146	136	108
TURNS DISPLACEMENT	5.40	4.80	3.68
R-VALUE UNCORRECTED	4	8	25
R-VALUE CORRECTED	4	8	21
EXPANSION PRESSURE (psf)	0.0	17.3	116.6

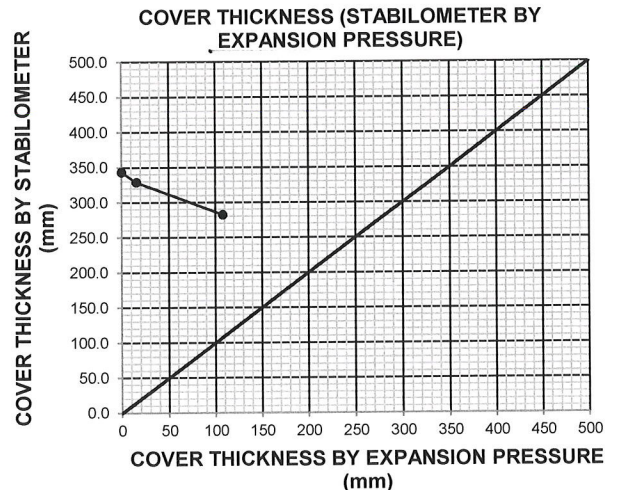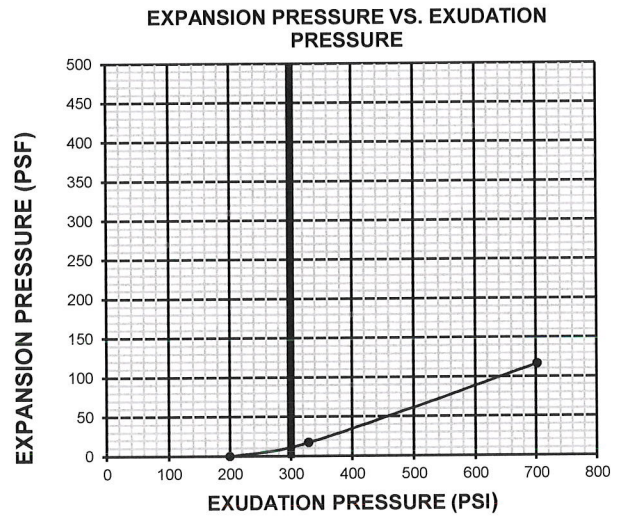
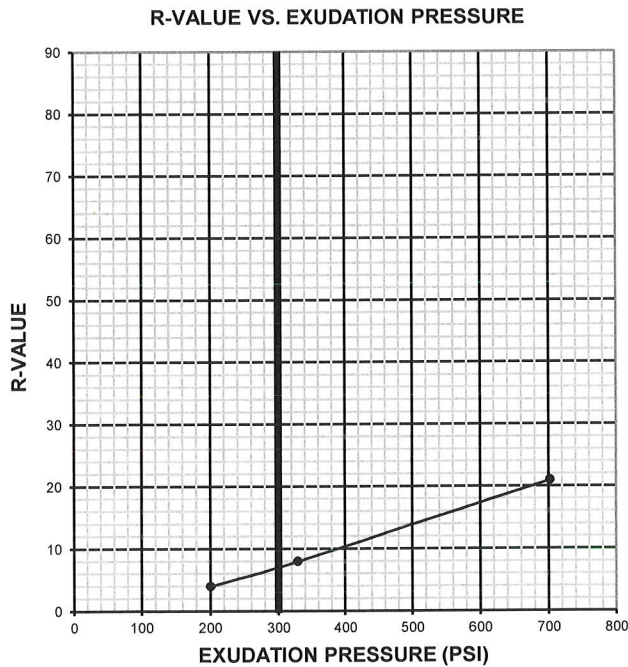


R-VALUE AT EQUILIBRIUM: 7

R-VALUE BY EXUDATION PRESSURE:	7
R-VALUE BY EXPANSION PRESSURE:	N.A.
EXPANSION PRESSURE AT 300 PSI EXUDATION:	10
TRAFFIC INDEX (Assumed):	5.5
GRAVEL FACTOR (Assumed):	1.5
UNIT MASS OF COVER MATERIAL, kg/m ³ (Assumed):	2100.0

Sample No. B4@2'
 Sample Type: Undisturbed/Saturated
 Soil Description: Silty Clay w/ Some Gravel

		1	2	3
Normal Stress	(psf)	1000	2000	3000
Peak Stress	(psf)	852	1296	1812
Displacement	(in)	0.225	0.225	0.225
Residual Stress	(psf)	852	1284	1812
Displacement	(in.)	0.250	0.250	0.250
In Situ Dry Density	(pcf)	107.1	107.1	107.1
In Situ Water Content	(%)	17.6	17.6	17.6
Saturated Water Content	(%)	21.1	21.1	21.1
Strain Rate	(in/min)	0.020	0.020	0.020

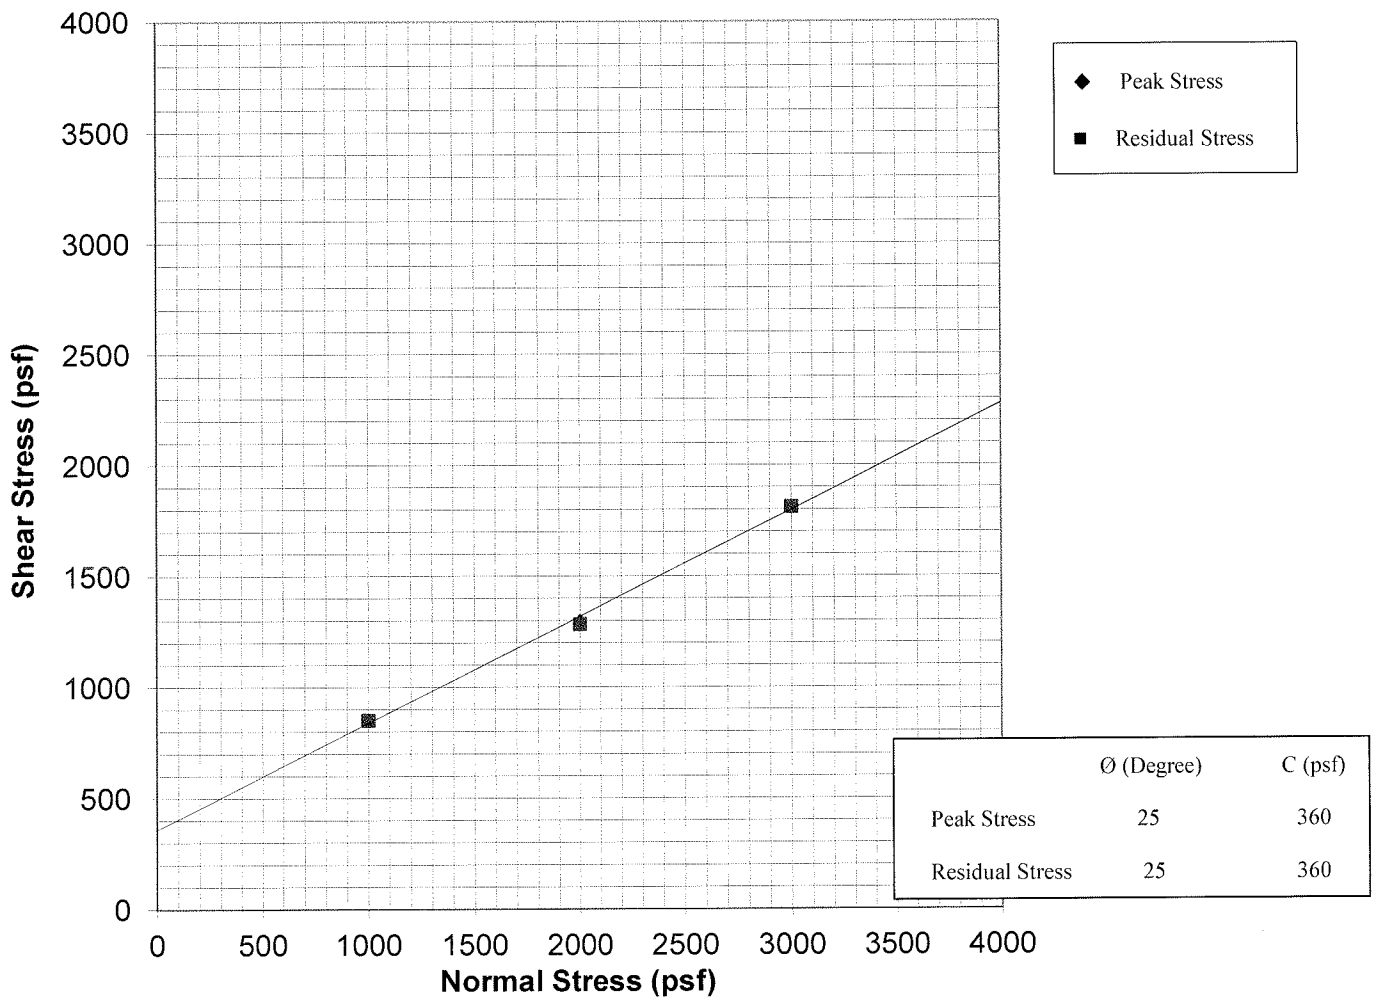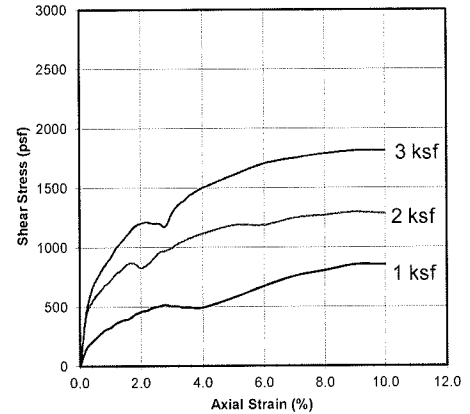

NorCal Engineering
 SOILS AND GEOTECHNICAL CONSULTANTS

Western Realco

PROJECT NUMBER: 22416-21

DATE: 4/2/2021



DIRECT SHEAR TEST

ASTM D3080

Plate A

Sample No. B11@2'
 Sample Type: Undisturbed/Saturated
 Soil Description: Silty Clay w/ Some Sand & Gravel

		1	2	3
Normal Stress	(psf)	1000	2000	3000
Peak Stress	(psf)	732	1356	1920
Displacement	(in.)	0.175	0.250	0.250
Residual Stress	(psf)	732	1356	1920
Displacement	(in.)	0.250	0.250	0.250
In Situ Dry Density	(pcf)	102.6	102.6	102.6
In Situ Water Content	(%)	17.3	17.3	17.3
Saturated Water Content	(%)	23.7	23.7	23.7
Strain Rate	(in/min)	0.020	0.020	0.020

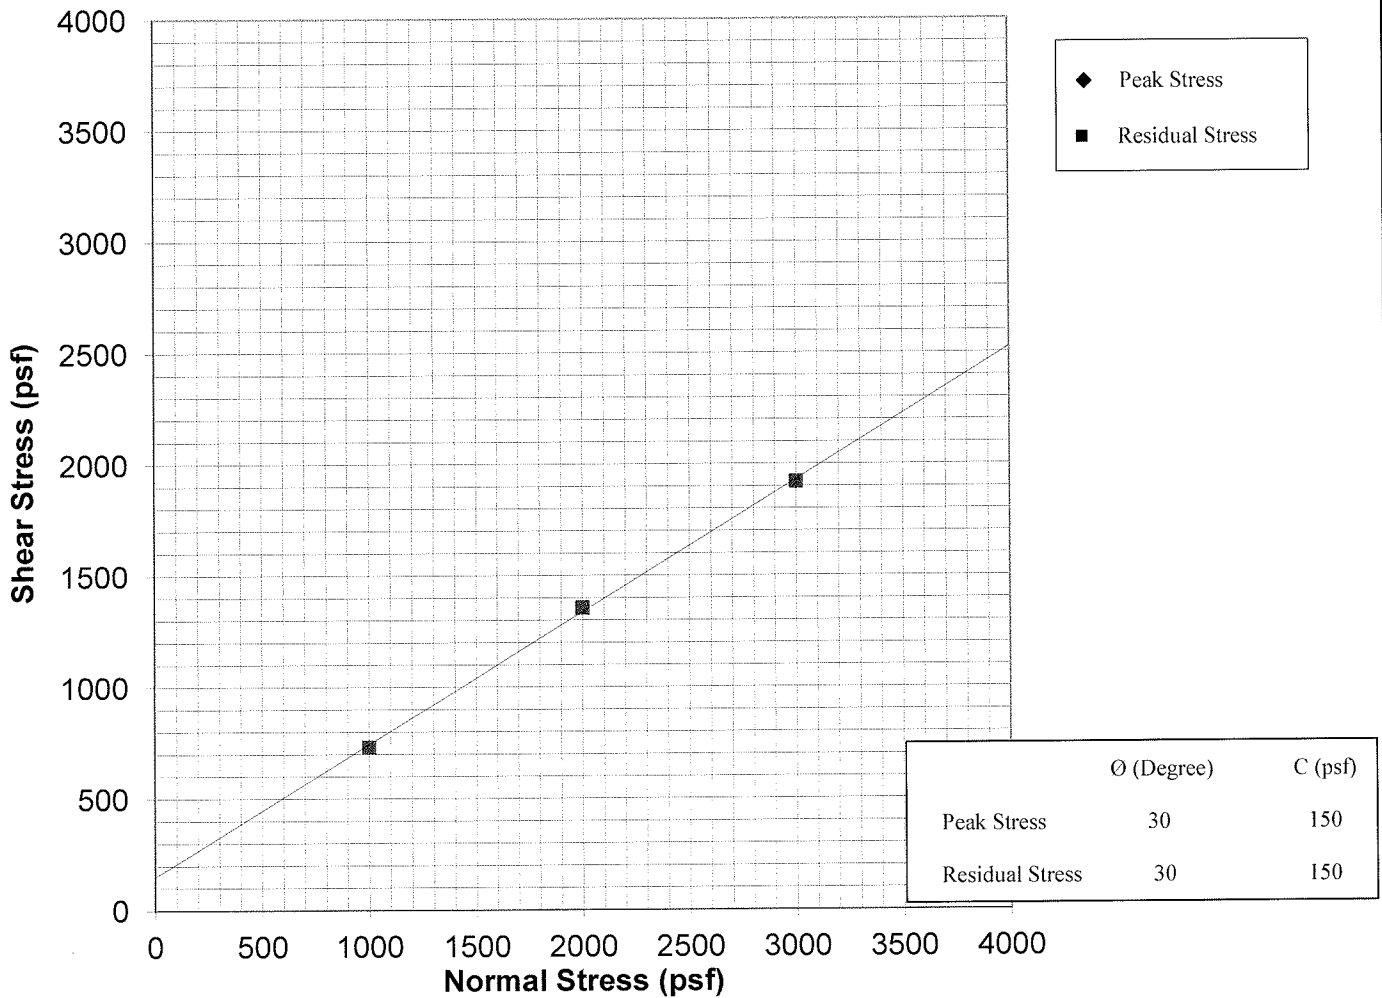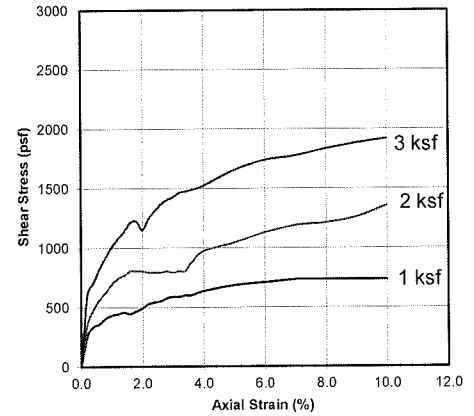

NorCal Engineering
 SOILS AND GEOTECHNICAL CONSULTANTS

Western Realco

PROJECT NUMBER: 22416-21

DATE: 4/2/2021

DIRECT SHEAR TEST

ASTM D3080


Plate B

Vertical Pressure (kips/sq.ft.)	Sample Height (inches)	Consolidation (percent)	Sample No.	B4	Depth	5'	Date	4/2/2021
---------------------------------	------------------------	-------------------------	------------	----	-------	----	------	----------

0.125	1.0000	0.0
0.25	0.9911	0.9
0.5	0.9843	1.6
1	0.9739	2.6
1	0.9707	2.9
2	0.9578	4.2
4	0.9379	6.2
8	0.9140	8.6
0.25	0.9270	7.3

Date Tested: 3/31/2021
Sample: B4
Depth: 5'

Saturated

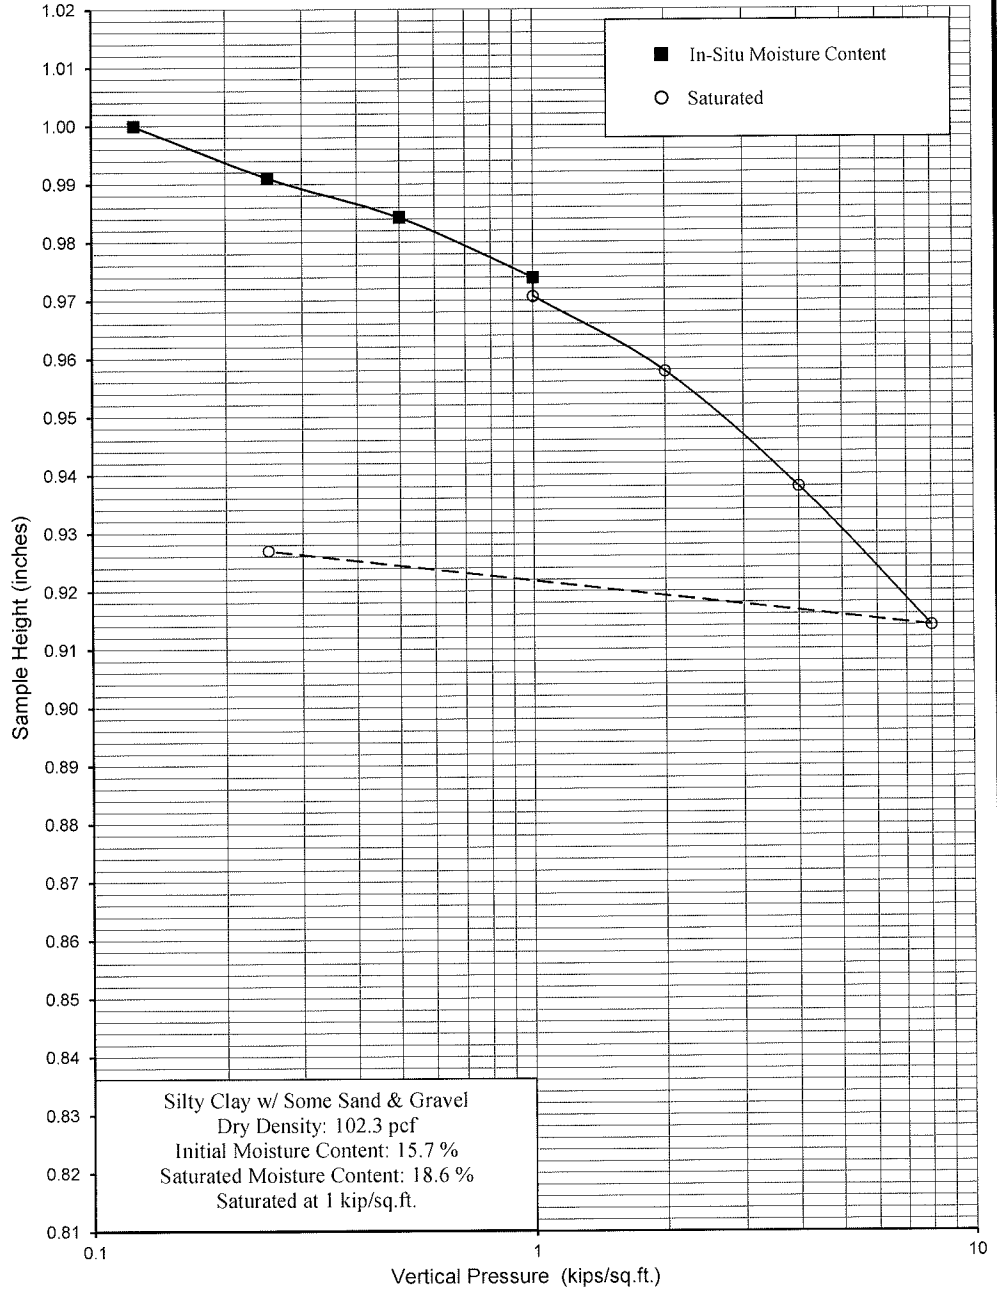

Silty Clay w/ Some Sand & Gravel
Dry Density: 102.3 pcf
Initial Moisture Content: 15.7 %
Saturated Moisture Content: 18.6 %
Saturated at 1 kip/sq.ft.

NorCal Engineering

SOILS AND GEOTECHNICAL CONSULTANTS

Western Realco

PROJECT NUMBER: 22416-21

DATE: 4/2/2021

CONSOLIDATION TEST

ASTM D2435


Plate C

Vertical Pressure (kips/sq.ft.)	Sample Height (inches)	Consolidation (percent)	Sample No.	B4	Depth	10'	Date	4/2/2021
------------------------------------	------------------------	----------------------------	------------	----	-------	-----	------	----------

0.125	1.0000	0.0
0.25	0.9990	0.1
0.5	0.9970	0.3
1	0.9925	0.8
1	0.9900	1.0
2	0.9850	1.5
4	0.9750	2.5
8	0.9610	3.9
0.25	0.9770	2.3

Saturated

Date Tested: 4/1/2021
Sample: B4
Depth: 10'

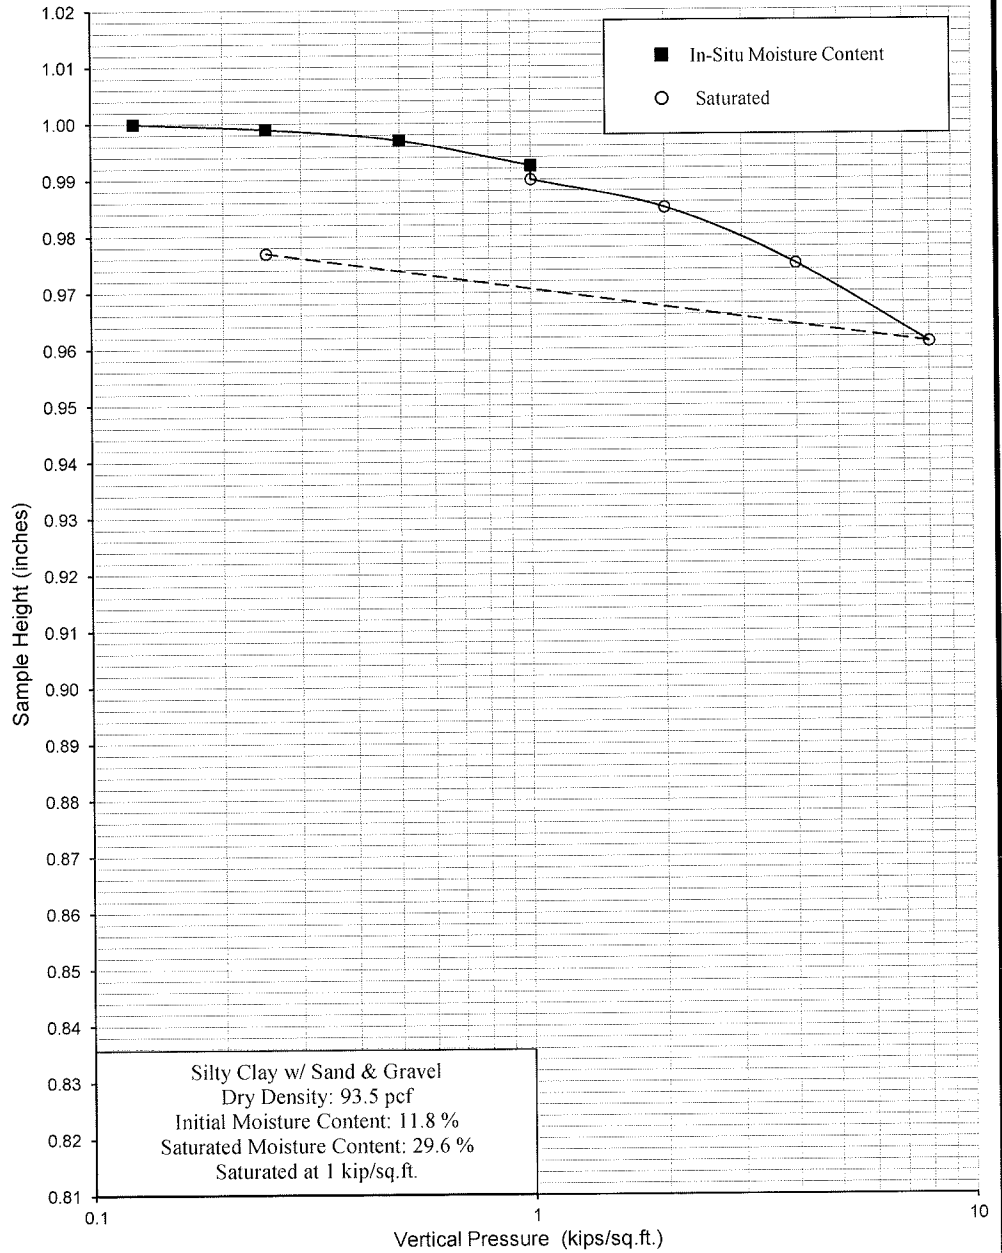

Silty Clay w/ Sand & Gravel
Dry Density: 93.5 pcf
Initial Moisture Content: 11.8 %
Saturated Moisture Content: 29.6 %
Saturated at 1 kip/sq. ft.

NorCal Engineering

SOILS AND GEOTECHNICAL CONSULTANTS

Western Realco

PROJECT NUMBER: 22416-21

DATE: 4/2/2021

CONSOLIDATION TEST

ASTM D2435


Plate D

Vertical Pressure (kips/sq.ft.)	Sample Height (inches)	Consolidation (percent)	Sample No.	B11	Depth	5'	Date	4/2/2021
------------------------------------	------------------------	----------------------------	------------	-----	-------	----	------	----------

0.125	1.0000	0.0
0.25	0.9980	0.2
0.5	0.9960	0.4
1	0.9905	1.0
1	0.9830	1.7
2	0.9715	2.9
4	0.9480	5.2
8	0.9160	8.4
0.25	0.9260	7.4

Saturated

Date Tested: 4/1/2021
Sample: B11
Depth: 5'

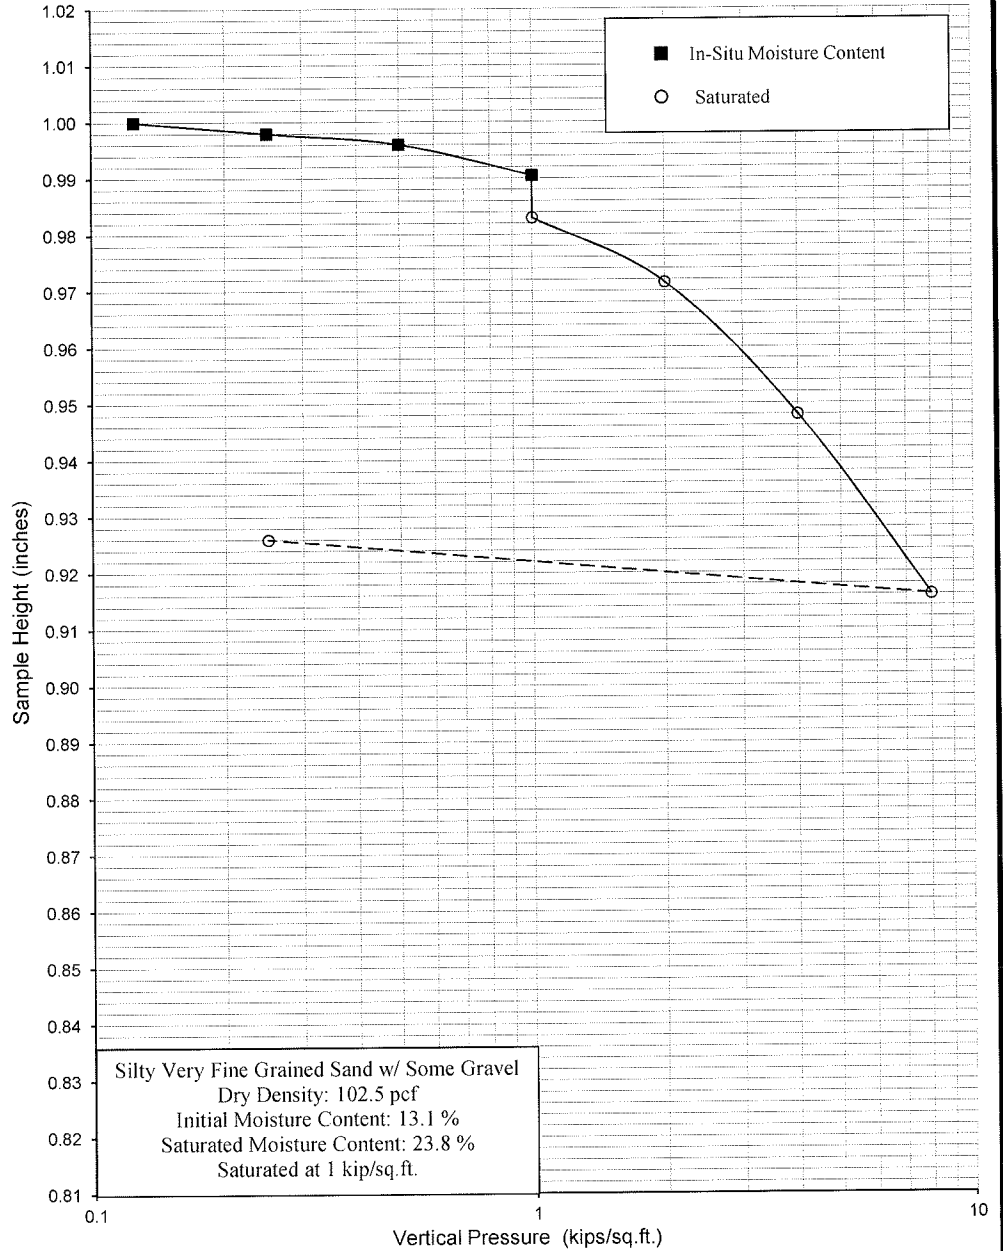

NorCal Engineering

SOILS AND GEOTECHNICAL CONSULTANTS

Western Realco

PROJECT NUMBER: 22416-21

DATE: 4/2/2021

CONSOLIDATION TEST

ASTM D2435

Plate E



Appendix C

ASCE 7 Hazards Report

Address:
12352 Whittier Blvd
Whittier, California
90602

Standard: ASCE/SEI 7-16
Risk Category: II
Soil Class: D - Stiff Soil

Elevation: 216.42 ft (NAVD 88)
Latitude: 33.972934
Longitude: -118.047425

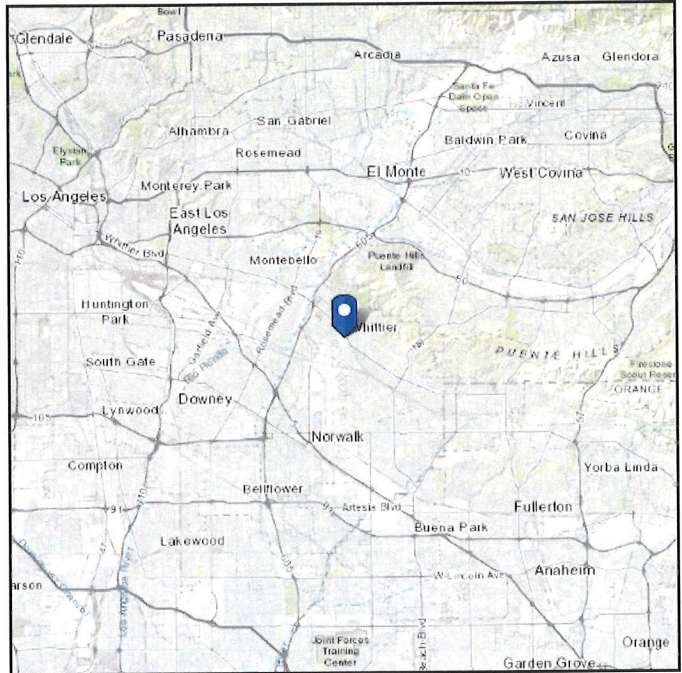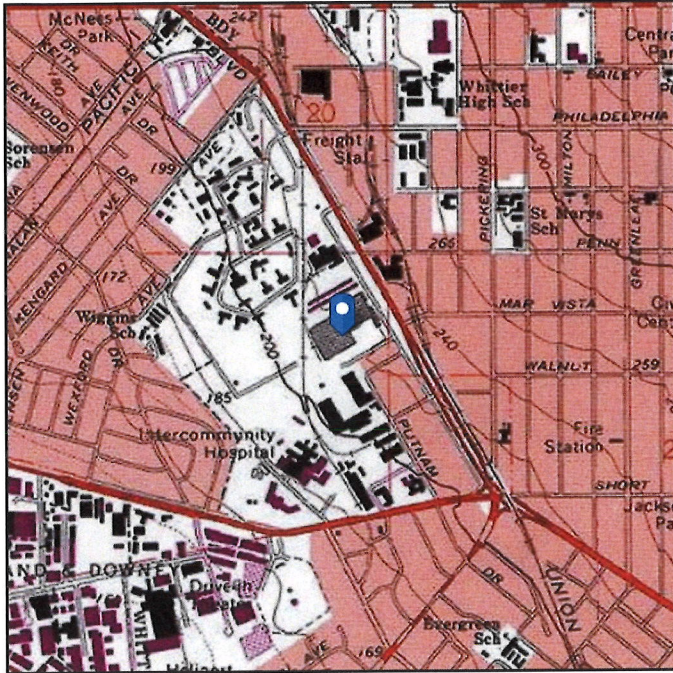

Seismic

Site Soil Class: D - Stiff Soil

Results:

S_s :	1.837	S_{D1} :	N/A
S_1 :	0.655	T_L :	8
F_a :	1	PGA :	0.796
F_v :	N/A	PGA _M :	0.876
S_{MS} :	1.837	F_{PGA} :	1.1
S_{M1} :	N/A	I_e :	1
S_{DS} :	1.224	C_v :	1.467

Ground motion hazard analysis may be required. See ASCE/SEI 7-16 Section 11.4.8.

Data Accessed: Sun Mar 28 2021

Date Source: [USGS Seismic Design Maps](#)

The ASCE 7 Hazard Tool is provided for your convenience, for informational purposes only, and is provided "as is" and without warranties of any kind. The location data included herein has been obtained from information developed, produced, and maintained by third party providers; or has been extrapolated from maps incorporated in the ASCE 7 standard. While ASCE has made every effort to use data obtained from reliable sources or methodologies, ASCE does not make any representations or warranties as to the accuracy, completeness, reliability, currency, or quality of any data provided herein. Any third-party links provided by this Tool should not be construed as an endorsement, affiliation, relationship, or sponsorship of such third-party content by or from ASCE.

ASCE does not intend, nor should anyone interpret, the results provided by this Tool to replace the sound judgment of a competent professional, having knowledge and experience in the appropriate field(s) of practice, nor to substitute for the standard of care required of such professionals in interpreting and applying the contents of this Tool or the ASCE 7 standard.

In using this Tool, you expressly assume all risks associated with your use. Under no circumstances shall ASCE or its officers, directors, employees, members, affiliates, or agents be liable to you or any other person for any direct, indirect, special, incidental, or consequential damages arising from or related to your use of, or reliance on, the Tool or any information obtained therein. To the fullest extent permitted by law, you agree to release and hold harmless ASCE from any and all liability of any nature arising out of or resulting from any use of data provided by the ASCE 7 Hazard Tool.

Appendix D



SOILS AND GEOTECHNICAL CONSULTANTS

PERCOLATION TEST DATA

Client: Western Realco	Tested By: D.R.
Project No.: 22416-21	Date Tested: 3/22/2021
Test Hole: B-1	Caving:
Depth of Test Hole: 5'	Notes:
Diameter of Test Hole: 6"	
Date Excavated: 3/22/2021	

PRE-SOAK

TIME	PRE-SOAK NO.	TIME INTERVAL	TOTAL ELAPSED TIME	INITIAL WATER LEVEL	FINAL WATER LEVEL	CHANGE IN WATER LEVEL
8:06	1	12	12	48.0	60.0	12.0
8:18						
8:18	2	18	30	48.0	60.0	12.0
8:36						

PERCOLATION TEST

TIME	TEST NO.	TIME INTERVAL	TOTAL ELAPSED TIME	INITIAL WATER LEVEL	FINAL WATER LEVEL	CHANGE IN WATER LEVEL
8:36	1	10	10	48.0	54.0	6.0
8:46						
8:46	2	10	20	48.0	53.5	5.5
8:56						
8:56	3	10	30	48.0	53.5	5.5
9:06						
9:06	4	10	40	48.0	51.5	3.5
9:16						
9:16	5	10	50	48.0	53.0	5.0
9:26						
9:26	6	10	60	48.0	52.5	4.5
9:36						
9:36	7	10	70	48.0	52.5	4.5
9:46						
9:46	8	10	80	48.0	52.5	4.5
9:56						
9:56	9	10	90	48.0	53.0	5.0
10:06						
10:06	10	10	100	48.0	53.0	5.0
10:16						
10:16	11	10	110	48.0	52.0	4.0
10:26						
10:26	12	10	120	48.0	53.0	5.0
10:36						



SOILS AND GEOTECHNICAL CONSULTANTS

PERCOLATION TEST DATA

Client: Western Realco	Tested By: D.R.
Project No.: 22416-21	Date Tested: 3/22/2021
Test Hole: B-2	Caving:
Depth of Test Hole: 7.5'	Notes:
Diameter of Test Hole: 6"	
Date Excavated: 3/22/2021	

PRE-SOAK

TIME	PRE-SOAK NO.	TIME INTERVAL	TOTAL ELAPSED TIME	INITIAL WATER LEVEL	FINAL WATER LEVEL	CHANGE IN WATER LEVEL
7:03	1	30	30	75.0	84.0	9.0
7:33						
7:33	2	30	60	75.0	82.0	7.0
8:03						

PERCOLATION TEST

TIME	TEST NO.	TIME INTERVAL	TOTAL ELAPSED TIME	INITIAL WATER LEVEL	FINAL WATER LEVEL	CHANGE IN WATER LEVEL
12:03	1	30	30	75.0	77.5	2.5
12:33						
12:33	2	30	60	75.0	79.0	4.0
1:03						
1:03	3	30	90	75.0	79.0	4.0
1:33						
1:33	4	30	120	75.0	79.5	4.5
2:03						
2:03	5	30	150	75.0	79.5	4.5
2:33						
2:33	6	30	180	75.0	79.0	4.0
3:03						
3:03	7	30	210	75.0	80.0	5.0
3:33						
3:33	8	30	240	75.0	79.0	4.0
4:03						



SOILS AND GEOTECHNICAL CONSULTANTS

PERCOLATION TEST DATA

Client: Western Realco	Tested By: D.R.
Project No.: 22416-21	Date Tested: 3/22/2021
Test Hole: B-3	Caving:
Depth of Test Hole: 10'	Notes:
Diameter of Test Hole: 6"	
Date Excavated: 3/22/2021	

PRE-SOAK

TIME	PRE-SOAK NO.	TIME INTERVAL	TOTAL ELAPSED TIME	INITIAL WATER LEVEL	FINAL WATER LEVEL	CHANGE IN WATER LEVEL
7:08	1	30	30	107.0	118.0	11.0
7:38						
7:38	2	30	60	105.5	115.5	10.0
8:08						

PERCOLATION TEST

TIME	TEST NO.	TIME INTERVAL	TOTAL ELAPSED TIME	INITIAL WATER LEVEL	FINAL WATER LEVEL	CHANGE IN WATER LEVEL
12:08	1	30	30	108.0	115.0	7.0
12:38						
12:38	2	30	100	108.0	115.0	7.0
1:08						
1:08	3	30	90	108.0	115.0	7.0
1:38						
1:38	4	30	120	108.0	117.0	9.0
2:08						
2:08	5	30	150	108.0	117.0	9.0
2:38						
2:38	6	30	180	108.0	117.0	9.0
3:08						
3:08	7	30	210	108.0	115.0	7.0
3:38						
3:38	8	30	240	108.0	115.0	7.0
4:08						

SOIL INFILTRATION RATE CALCS ⇒ Auger Boring

Location:	B-1	B-2	B-3
• Depth =	5.0'	7.5'	10.0'
• Hole Dia. =	6"	6"	6"
• Drop = Δd	4"	4"	7"
• Time = Δt Interval	10 min	30 min	30 min
• Preadjusted Perc. Rate	24 in/hr	8 in/hr	14 in/hr
• Initial Water Depth = d_1	12"	15"	12"
• Reduction Factor = R_f	4.33	5.33	3.83
• INFILTRATION RATE	5.5 in/hr	1.5 in/hr	3.7 in/hr

$$\text{Infiltration Rate} = \frac{\text{Preadjusted Perc. Rate}}{\text{Reduction Factor}}$$

$$\text{Reduction Factor} = R_f = \left[\frac{2 \cdot d_1 - \Delta d}{\text{Dia.}} \right] + 1$$

NorCal Engineering
SOILS AND GEOTECHNICAL CONSULTANTS

JOB NO. 22416-21 DATE MARCH, 2021